

Weld Field Immune Proximity Sensors

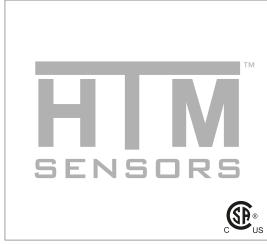

Dimensions

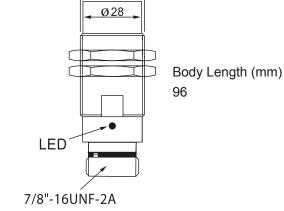

M30x1.5

Note: The product images shown may change over time as products are updated.


Part Number WCN2-3015U-AZU3Y

Features

Inductive Proximity Sensors are used in a wide variety of manufacturing operations where a metal target needs to be sensed. HTM Sensors inductive proximity sensors have a Lifetime Warranty, a CSA or UL approval, and a huge inventory for sameday shipping. For tougher applications where the sensors need more range to stay out of harm's way, or to withstand high temperatures, weld spatter, chemical exposure, oil or other rough environments, HTM Sensors has the widest range of proximity sensors on the market.

Connection

SENSORS

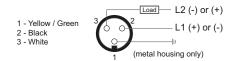



Technical Data

| Teenmear Bata | |
|----------------------------|--|
| Body Style | Cylindrical |
| Sensor Housing Material | Chrome Plated Brass |
| Sensor Face Material | PBT Plastic |
| Mounting Style | Unshielded |
| Diameter | 30 mm Threaded |
| Sensing Range: | 15 mm Range |
| Output Type: | AC/DC Output |
| Output Function | Normally Open Output |
| Connection | 3-Pin Connector |
| Connector Type | Mini Quick-Connect |
| Operating Voltage | 20-250 VAC, 50-60HZ; 20-250 VDC |
| Switching Frequency | 25 Hz AC; 40 Hz DC |
| Operating Temperature | -25 °C – +70 °C |
| Current Consumption | <2.5mA |
| IP Rating: | IP67 |
| EMC Rating | RFI>3V/m / EFT>1kV / ESD>4Kv (contact) |
| Shock Rating: | IEC 60497-5-2 Part 7.4.1&7.4.2 |
| Short Circuit Protected | Yes |
| Reverse Polarity Protected | NO |
| Max Current | 200 mA |
| Leakage Current | <2.5mA |
| Surge Current | 2.2 A for 20 ms |
| Response Time | 10 ms/10 ms |
| Hysteresis | <15%(Sr) |
| Overload Trip Point | - |
| Weld Field Immune | Yes |
| Weld Spatter Resistant | No |
| Body Length (mm) | 96 |
| | |

In the USA: 1889 Maryland Ave., Niagara Falls, NY 14305 In Canada: 3419 Mainway, Burlington, ON L7M 1A9 Toll Free: 1-800-644-1756 • Fax: 888-283-2127 service@htmsensors.com

htmsensors.com