





LabWaste™ Technical Information Guide  
**Product Dimensions**

**P104X Trap Adapter - Female**  
 H x Slip w/ Chrome Nut & Washer

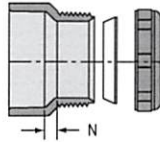


Part Number	Size	N
P104X-015C	1-1/2	3/16

**P105 Cleanout Adapter**  
 Spig x FPT

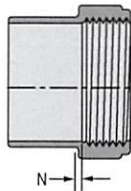


Part Number	Size	N
P105-015C	1-1/2	5/32
P105-020C	2	1/4
P105-030C	3	11/32
P105-040C	4	1/4
P105-060C	6	11/32
P105-080C	8	13/32

**P105X Cleanout Adapter with Square Head Plug**  
 Spig x FPT

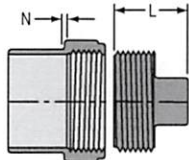


SEE PART NO. P105 AND P106

**P106 Square Head Cleanout Plug**  
 MPT



Part Number	Size	L
P106-015C	1-1/2	1-3/8
P106-020C	2	1-5/16
P106-030C	3	1-25/32
P106-040C	4	1-7/8
P106-060C	6	1-15/16
P106-080C	8	2-1/8

**P107 Flush Bushing**  
 Spig x H




Part Number	Size	L	N
P107-251C	2x1-1/2	1-1/16	7/32
P107-337C	3x1-1/2	1-3/4	1
P107-338C	3x2	1-25/32	1
P107-420C	4x2	2	1-3/16
P107-422C	4x3	2	1/2
P107-530C	6x3	3-23/32	2-11/32
P107-532C	6x4	3-7/16	1-11/16
P107-582C	8x4	4-9/16	2-13/16
P107-585C	8x6	4-19/32	1-9/16
P107-628C	10x8	5-11/32	1-5/16

**P108 Flush Bushing (Cleanout Adapter)**  
 S x FPT



Part Number	Size	L	N
P108-212C	1-1/2x1-1/4	7/8	3/16

**P109 Male Adapter**  
 MPT x H

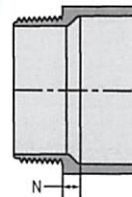

Part Number	Size	N
P109-169C	1-1/4x1-1/2	3/16
P109-015C	1-1/2	3/16
P109-020C	2	3/16
P109-030C	3	3/8
P109-040C	4	3/8
P109-060C	6	11/16