



Revision Number: 005.3

Issue date: 04/09/2025

1. IDENTIFICATION


Product name:	LOCTITE FREKOTE 1711 known as FREKOTE 1711-I	IDH number:	420400
Product type/ Recommended use:	Mold Release	Item number:	83417
Restriction of Use:	None identified	Region:	United States
Company address:	Henkel Corporation One Henkel Way Rocky Hill, Connecticut 06067	Contact information:	Telephone: +1 (860) 571-5100 MEDICAL EMERGENCY Phone: Poison Control Center 1-877-671-4608 (toll free) or 1-303-592-1711 TRANSPORT EMERGENCY Phone: CHEMTREC 1-800-424-9300 (toll free) or 1-703-527-3887 MEDICAL EMERGENCY Phone: Poison Control Center 1-877-671-4608 (toll free) or 1-303-592-1711 TRANSPORT EMERGENCY Phone: CHEMTREC 1-800-424-9300 (toll free) or 1-703-527-3887 Internet: www.henkelna.com

2. HAZARDS IDENTIFICATION

EMERGENCY OVERVIEW

DANGER: H225 - HIGHLY FLAMMABLE LIQUID AND VAPOUR.
H304 - MAY BE FATAL IF SWALLOWED AND ENTERS AIRWAYS.
H315 - CAUSES SKIN IRRITATION.
H319 - CAUSES SERIOUS EYE IRRITATION.
H336 - MAY CAUSE DROWSINESS OR DIZZINESS.

HAZARD CLASS	HAZARD CATEGORY
FLAMMABLE LIQUID	2
SKIN IRRITATION	2
EYE IRRITATION	2A
SPECIFIC TARGET ORGAN TOXICITY - SINGLE EXPOSURE	3
ASPIRATION HAZARD	1

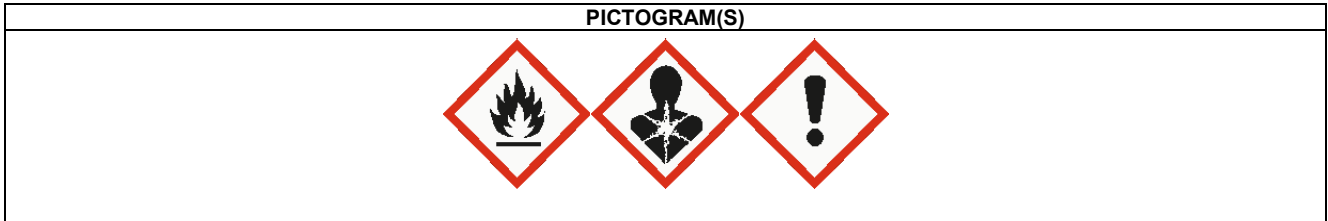

Precautionary Statements

Prevention:	P210 - Keep away from heat, sparks, open flames, hot surfaces - no smoking. P233 - Keep container tightly closed. P240 - Ground and bond container and receiving equipment. P241 - Use explosion-proof equipment. P242 - Use non-sparking tools. P243 - Take action to prevent static discharges. P261 - Avoid breathing mist/vapours. P264 - Wash affected area thoroughly after handling. P271 - Use only outdoors or in a well-ventilated area.
Response:	P280 - Wear protective gloves, clothing, eye and face protection. P301+P310 - IF SWALLOWED: Immediately call a physician or poison control center. P303+P361+P353 - If on skin (or hair): Take off immediately all contaminated clothing. P304+P340+P312 - IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing. Call a POISON CENTER or physician if you feel unwell. P305+P351+P338 - IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.

IDH number: 420400

Product name: LOCTITE FREKOTE 1711 known as FREKOTE 1711-I

Storage: P331 - Do NOT induce vomiting.
 P332+P313 - If skin irritation occurs: Get medical attention.
 P337+P313 - If eye irritation persists: Get medical attention.
 P362+P364 - Take off contaminated clothing and wash it before reuse.
 P370+P378 - In case of fire: Use foam, dry chemical or carbon dioxide to extinguish.
 P403+P233 - Store in a well-ventilated place. Keep container tightly closed.
 P403+P235 - Store in a well-ventilated place. Keep cool.
 P405 - Store locked up.
Disposal: P501 - Dispose of contents and/or container according to Federal, State/Provincial and local governmental regulations.

Other hazards Not available.

Classification complies with OSHA Hazard Communication Standard (29 CFR 1910.1200) and is consistent with the provisions of the United Nations Globally Harmonized System of Classification and Labeling of Chemicals (GHS).

See Section 11 for additional toxicological information.

3. COMPOSITION / INFORMATION ON INGREDIENTS

Hazardous Component(s)	CAS Number	Weight %*
Alkanes, C7-10-iso-	90622-56-3	80 - 100
Stoddard solvent, <0.1% Benzene	8052-41-3	1 - 5
Xylenes	1330-20-7	0.1 - 1
Ethylbenzene	100-41-4	0.1 - 1

* Exact percentages may vary or are trade secret. Concentration range is provided to assist users in providing appropriate protections.

4. FIRST AID MEASURES

First Aid Measures by likely routes of exposure

Inhalation: Move to fresh air. If breathing is difficult, give oxygen. If not breathing, give artificial respiration. Get immediate medical attention.

Skin contact: Remove contaminated clothing and footwear. Immediately flush skin with plenty of water (using soap, if available). If symptoms develop and persist, get medical attention. Wash clothing before reuse.

Eye contact: Rinse immediately with plenty of water, also under the eyelids, for at least 15 minutes. Get medical attention.

Ingestion: Do not induce vomiting. If vomiting occurs, prevent aspiration by keeping the patient's head below the knees. Never give anything by mouth to an unconscious person. Get immediate medical attention.

Most important symptoms and effects (acute and delayed): The most important known symptoms and effects, both acute and delayed, are described in Section 11: Toxicological Information.

Indication of any immediate medical attention / special treatment needed: This material is an aspiration hazard. Potential danger from aspiration must be weighed against possible oral toxicity when deciding whether to induce vomiting.

5. FIRE FIGHTING MEASURES

Extinguishing media: Water spray (fog), foam, dry chemical or carbon dioxide.

Improper extinguishing agents: Not available.

Special firefighting procedures: Wear self-contained breathing apparatus and full protective clothing, such as turn-out gear. In case of fire, keep containers cool with water spray.

Unusual fire or explosion hazards:

Vapors may form explosive mixtures with air. Do not handle or store near an open flame, heat or other sources of ignition. Hydrocarbon solvents are basically non-conductors of electricity and can become electrostatically charged during mixing, filtering or pumping at high flow rates. If this charge reaches a significantly high level, sparks can form that may ignite vapors of flammable liquids.

Hazardous combustion products:

Oxides of carbon. Toxic and irritating vapors.

6. ACCIDENTAL RELEASE MEASURES

Use personal protection recommended in Section 8, isolate the hazard area and deny entry to unnecessary and unprotected personnel.

Environmental precautions:

Do not allow product to enter sewer or waterways. Advise authorities if product has entered or may enter sewers, water sources or extensive land areas. Prevent further leakage or spillage if safe to do so. This product is insoluble in water and will float on surface.

Clean-up methods:

Remove all sources of ignition. Ventilate area. Keep upwind of the spilled material and isolate exposure. Soak up with inert absorbent material (e.g. sand, silica gel, acid binder, universal binder, sawdust). Store in a closed metal container until ready for disposal. Refer to Section 8 "Exposure Controls / Personal Protection" prior to clean up.

7. HANDLING AND STORAGE

Handling:

During use and until all vapors are gone: Keep area ventilated - do not smoke; extinguish all flames, pilot lights, and heaters; turn off stoves, electrical tools and appliances, and any other sources of ignition. Make sure containers are properly grounded before use or transfer of material. Prevent contact with eyes, skin and clothing. Do not breathe vapor and mist. Wash thoroughly after handling. Do not taste or swallow. For operations where eye or face contact could occur, provide safety shower and eyewash fountain.

Storage:

For safe storage, store at or below 48.8 °C (119.8 °F) Keep in a cool, well ventilated area away from heat, sparks and open flame. Keep container tightly closed until ready for use.

Shelf Life Statement: Not available.

8. EXPOSURE CONTROLS / PERSONAL PROTECTION

Employers should complete an assessment of all workplaces to determine the need for, and selection of, proper exposure controls and protective equipment for each task performed.

Hazardous Component(s)	ACGIH TLV	OSHA PEL	AIHA WEEL	OTHER
Stoddard solvent, <0.1% Benzene	100 ppm TWA	500 ppm (2,900 mg/m ³) PEL	None	None
Ethylbenzene	20 ppm TWA	100 ppm (435 mg/m ³) PEL	None	None

Engineering controls:

Use explosion-proof mechanical ventilation and local exhaust to control contaminants to within their occupational exposure limits during the use of this product.

Respiratory protection:

Use a NIOSH approved supplied air respirator with an organic cartridge if the potential to exceed established exposure limits exists.

Eye/face protection:

Safety goggles or safety glasses with side shields. Full face protection should be used if the potential for splashing or spraying of product exists. Safety showers and eye wash stations should be available.

Skin protection:

Use impermeable gloves and protective clothing as necessary to prevent skin contact.

9. PHYSICAL AND CHEMICAL PROPERTIES

Physical state:	Liquid
Color:	Colourless / Colorless
Odor:	Mild
Odor threshold:	Not available.
pH:	Not applicable
Vapor pressure:	39 mm hg Estimated
Boiling point/range:	> 94.4 °C (> 201.9 °F)
Melting point/ range:	Not available.
Density/Relative density:	0.712
Relative vapor density:	Not available.
Flash point:	-2 °C (28.4 °F) Tagliabue closed cup
Flammable/Explosive limits - lower:	Not available.
Flammable/Explosive limits - upper:	Not available.
Autoignition temperature:	Not available.
Flammability:	Not applicable
Evaporation rate:	Not available.
Solubility:	Insoluble Water
Partition coefficient n-octanol/water (logarithmic value):	Not available.
VOC content:	97.68 %; 695.5 g/l EPA Method 24
Dynamic viscosity:	Not available.
Kinematic viscosity:	Not available.
Particle characteristics:	Not available.
Decomposition temperature:	Not available.

10. STABILITY AND REACTIVITY

Stability:	Stable under normal conditions of storage and use.
Hazardous reactions:	Will not occur.
Hazardous decomposition products:	Oxides of carbon. Irritating organic fragments.
Incompatible materials:	Strong oxidizing agents.
Reactivity:	Not available.
Conditions to avoid:	Exposure to air or moisture over prolonged periods. Avoid static discharge. Vapors may form explosive mixtures with air. Spray mist may be flammable at temperatures below the flash point. Keep away from open flames, hot surfaces and sources of ignition. Fire or intense heat may cause violent rupture of packages.

11. TOXICOLOGICAL INFORMATION

Likely routes of exposure:	Skin, Inhalation, Eyes, Ingestion
-----------------------------------	-----------------------------------

Potential Health Effects/Symptoms

Inhalation: Vapors and mists will irritate nose and throat and possibly eyes. May cause central nervous system effects with nausea, dizziness and headache.

Skin contact: Causes skin irritation. Solvent action can dry and defat the skin, causing the skin to crack, leading to dermatitis.

Eye contact: Causes serious eye irritation.

Ingestion: Principal hazard of ingestion is aspiration into the lungs and subsequent pneumonitis.

Hazardous Component(s)	LD50s and LC50s
Alkanes, C7-10-iso-	None
Stoddard solvent, <0.1% Benzene	None
Xylenes	Oral LD50 (Rat) = 6,670 mg/kg Oral LD50 (Rat) = 3,523 - 8,600 mg/kg Oral LD50 (Rat) = 4,300 mg/kg Dermal LD50 (Rabbit) = > 43 g/kg Inhalation LC50 (Rat, 4 h) = 6580 ppm Inhalation LC50 (Rat, 4 h) = 6247 ppm Inhalation LC50 (Rat, 4 h) = 5922 ppm Inhalation LC50 (Rat, 4 h) = 6700 ppm Inhalation LC50 (Rat, 4 h) = 6350 ppm
Ethylbenzene	Oral LD50 (Rat) = 5.46 g/kg Oral LD50 (Rat) = 3,500 mg/kg Dermal LD50 (Rabbit) = 17,800 mg/kg Inhalation LC50 (Rat, 4 h) = 4000 ppm

Hazardous Component(s)	Immediate Health Effects	Delayed Health Effects	Chronic Health Effects
Alkanes, C7-10-iso-	Irritant		Central nervous system Lung Cardiac
Stoddard solvent, <0.1% Benzene	Irritant		Central nervous system
Xylenes	Irritant		Cardiac Central nervous system Kidney Liver
Ethylbenzene	Irritant		Central nervous system

Hazardous Component(s)	NTP Carcinogen	IARC Carcinogen	OSHA Carcinogen (Specifically Regulated)
Alkanes, C7-10-iso-	No	No	No
Stoddard solvent, <0.1% Benzene	No	No	No
Xylenes	No	No	No
Ethylbenzene	No	Group 2B	No

12. ECOLOGICAL INFORMATION

Ecological information: Not available.

13. DISPOSAL CONSIDERATIONS

Information provided is for unused product only.

Recommended method of disposal: Follow all local, state, federal and provincial regulations for disposal.

14. TRANSPORT INFORMATION

The transport information provided in this section only applies to the material/formulation itself, and is not specific to any packaging.

U.S. Department of Transportation Ground (49 CFR)

Proper shipping name: Resin solution
Hazard class or division: 3
Identification number: UN 1866
Packing group: II
DOT Hazardous Substance(s): Xylene (mixed)

International Air Transportation (ICAO/IATA)

Proper shipping name: Resin solution
Hazard class or division: 3
Identification number: UN 1866
Packing group: II

Water Transportation (IMO/IMDG)

Proper shipping name: RESIN SOLUTION (Isoalkane C7 - C10)
Hazard class or division: 3
Identification number: UN 1866
Packing group: II
Marine pollutant: Isoalkane C7 - C10

15. REGULATORY INFORMATION**United States Regulatory Information**

TSCA 8 (b) Inventory Status: All components are listed as active or are exempt from listing on the Toxic Substances Control Act (TSCA) inventory.

TSCA 12 (b) Export Notification: None above reporting de minimis

CERCLA/SARA Section 302 EHS: None above reporting de minimis.
CERCLA/SARA Section 311/312: Please refer to the GHS classification in Section 2
CERCLA/SARA Section 313: This product contains the following toxic chemicals subject to the reporting requirements of section 313 of the Emergency Planning and Community Right-To-Know Act of 1986 (40 CFR 372). Ethylbenzene (CAS# 100-41-4).
CERCLA Reportable quantity: Xylenes (CAS# 1330-20-7) 100 lbs. (45.4 kg)

California Proposition 65: This product contains a chemical known in the State of California to cause cancer. This product contains a chemical known to the State of California to cause birth defects or other reproductive harm.

Canada Regulatory Information

CEPA DSL/NDSL Status: All components are listed on or are exempt from listing on the Canadian Domestic Substances List.

16. OTHER INFORMATION

This safety data sheet contains changes from the previous version in sections: 2

Prepared by: Product Safety and Regulatory Affairs

Issue date: 04/09/2025

DISCLAIMER: The data contained herein are furnished for information only and are believed to be reliable. However, Henkel Corporation and its affiliates ("Henkel") does not assume responsibility for any results obtained by persons over whose methods Henkel has no control. It is the user's responsibility to determine the suitability of Henkel's products or any production methods mentioned herein for a particular purpose, and to adopt such precautions as may be advisable for the protection of property and persons against any hazards that may be involved in the handling and use of any Henkel's products. In light of the foregoing, Henkel specifically disclaims all warranties, express or implied, including warranties of merchantability and fitness for a particular purpose, arising from sale or use of Henkel's products. Henkel further disclaims any liability for consequential or incidental damages of any kind, including lost profits.

This Safety Data Sheet has been generated based on OSHA Hazard Communication Standard (29 CFR 1910.1200) and provides information in accordance with U.S. federal law only. No warranty or representation of any kind is given with respect to the substantive or export laws of any other jurisdiction or country. Please confirm that the information provided herein conforms to the substantive export or other law of any other jurisdiction prior to export. Please contact Henkel Product Safety and Regulatory Affairs for additional assistance.